



SERVICE ALERT

DIRECT-TO WAYPOINT SELECTION

Service Alert: 050721-00

AFFECTED PRODUCTS:

- **GNS 430/420/400 Main S/W versions 2.08 through 5.00**
- **All GNS 530/500 Main S/W versions through 6.00**
- **All G1000 GDU S/W versions through 5.00**

ISSUE

In certain limited circumstances, conflicting navigation information can be provided when a selected 'Direct-to' waypoint is also a waypoint in a loaded terminal/approach procedure.

IMMEDIATE ACTION REQUIRED

This issue concerns only 'Direct-to' navigation to a waypoint that is already part of the loaded or active terminal/approach procedure. In this specific situation, the following applies:

- The 'Direct-to' waypoint must be selected **only** by highlighting that waypoint in the flight plan and pressing the 'Direct-to' key. Do **not** use any other method of entering the 'Direct-to' waypoint.

RESOLUTION

This issue will be resolved with the update of the system software as follows:

- **GNS 430/420/400 Main S/W version 5.01**
- **All GNS 530/500 Main S/W version 6.01**
- **All G1000 GDU S/W version 5.01**