

## SERVICE ADVISORY

NO.: 2191 Rev B

**TO:** G500/G600 TXi Owners and Operators  
**DATE:** October 21, 2021  
**SUBJECT:** Indicated Airspeed (IAS) and Vertical Speed (VS) Bugs  
**REVISION B:** Added the G600 TXi


---

### PRODUCTS AFFECTED

G500/G600 TXi systems with software versions 3.22 and later interfaced to a GFC 500 are affected.

### ISSUE

The IAS bug always indicates the IAS flight director mode is activated, even when the IAS flight director mode is not activated.

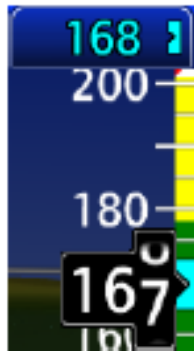

**Solid IAS Bug Indicating the IAS Flight Director Mode is Activated**

The VS bug always indicates the VS flight director mode is activated, even when the VS flight director mode is not activated.



**Solid VS Bug Indicating the VS Flight Director Mode is Activated**

© 2021 Garmin Ltd. or its subsidiaries.  
This work is licensed under a  
Creative Commons Attribution-NonCommercial-NoDerivs 3.0 Unported License.

## **SERVICE ADVISORY**

### **ACTION**

Be aware the IAS and VS flight director always appears as activated.

### **RESOLUTION**

This will be fixed in a future software release.